



Date: Thursday, 12/04/2007 7:52:00 AM
 User: Linda Lacelle

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services
 Job Number : 31807
 Estimate Number : 10467
 P.O. Number : N/A
 This Issue : 12/04/2007 S.O. No. : N/A
 Prsht Rev. : NC
 First Issue : N/A Type : MACHINED PARTS
 Previous Run : 31808
 Written By : 
 Checked & Approved By : 
 Comment : Est. A 05.09.13 New issue KJ/JLM
 Est. B 06.02.10 Dwg rev.D echn 773 EC
 Est. C 06.05.02 Added inspections EC
 est D 07.03.13 rev F dwg EC

Drawing Name : FWD TUBE ASSEMBLY
 Part Number : D3391021
 Drawing Number : D3391 REV.F
 Project Number : N/A
 Drawing Revision : F
 Material : N/A
 Due Date : 19/04/2007 Qty: 1 Um: Each

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 D6013047 SKIDTUBE MAT'L



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 SKIDTUBE MAT'L

Pick:

Qty	Part Number	Description	Batch
1	D6013-047	Extrusion	B26547

DP 7-4-12

2.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1
 Cut extrusion to 46.52 +0.010 -0.020

DP 7-4-12

3.0 BENDING BENDING MACHINE



Comment: Nc bender
 Bend as per Dwg D3391 Using Bend Prog 3391021

ELR 07-04-12

4.0 QQ5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 07-04-12

5.0 HAAS1 HAAS CNC VERTICAL MACHINING #1



Comment: HAAS CNC VERTICAL MACHINING #1
 1-Machine as per Folio FA590 Rev. AA & Dwg D3391 Rev. E
 Identify as D3391-1

J.L 07/05/14

(P70)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: RD Date: 07/05/12

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
7-4-12	4	Tube over bent by .125"	<i>[Signature]</i> 05/04/12	Acceptable	EL 7-4-12	<i>[Signature]</i> 07/04/12	<i>[Signature]</i> 07/04/12	<i>[Signature]</i> 07-04-12
07/01/12	5-0	Dimension is 3.635 on the 3.590 to 0.025" O.D. Marked 3.609 on FAI. Part was measured with the plug installed.	<i>[Signature]</i> 05/04/12	Change to re-install & re-machine. Grind slot to dimension, open fitting to mid tube, and bring in to tolerance.	<i>[Signature]</i>	<i>[Signature]</i>	<i>[Signature]</i> 05/04/12	<i>[Signature]</i> 07/05/12
↓	↓	u //	↓	Try and re-machine into tolerance, per dwg.	J.L. 07/05/12	9ml 07/05/12	↓	↓

NOTE: Date & initial all entries

Date: Thursday, 12/04/2007 7:52:00 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 31807

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

2-Debur

6.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

7.0

MILLING CONV.

CONVENTIONAL MILLING MACHINE



Comment: CONVENTIONAL MILLING MACHINE

Drill X1 Aft cap as per Dwg D3391

8.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

9.0

QC8

SECOND CHECK



Comment: SECOND CHECK

10.0

MILLING CONV.

CONVENTIONAL MILLING MACHINE



Comment: CONVENTIONAL MILLING MACHINE

Drill one fwd cap hole to dia.0.128" per DWG D3391 one side only

Already been up-dated.

11.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill and c'sink float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size)
(ONLY DRILL HOLES MARKED "A")

2-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step

3-Open tow cap holes to .208" as per Dwg D3391

4-Open Tow Ring hole to .640" as per Dwg D3391

5-Debur

7-5-23

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 12/04/2007 7:52:01 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 31807

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

CP 07/06/15

13.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

AWMK 07/27/24

14.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

M-F 07/08/10

15.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M 105068

BR/M-F 07-08-16

16.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL 07/08/17

17.0

NAS1330C3KB166

INSERT



Comment: Qty.: 20.0000 Each(s)/Unit Total: 20.0000 Each(s)

Rivnut

Pick:

Qty

Part Number

Description

Batch

14

NAS1330C3KB166

Insert

M 103279

M-F FL

18.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install Inserts as per Dwg

FL 07/08/17

19.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

CP 07/08/17

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 12/04/2007 7:52:01 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 31807

Part Number: D3391021

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

20.0	D3401041	Tow Cap Assembly
------	----------	------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Tow Cap Assembly

Pick:

Qty	Part Number	Description	Batch
1	D3401-041	Tow Cap	

B31346

M.L

21.0	D356413	WEARSHOE
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

B33800

M.L

22.0	D356613	GASKET
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

B32660

M.L

23.0	AN3C4A	BOLT
------	--------	------



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Bolt

Pick:

Qty	Part Number	Description	Batch
4	AN3C4A	Bolt	

M105143

M.L

24.0	NAS1515H3L	WASHER
------	------------	--------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Washer

Pick:

Qty	Part Number	Description	Batch
4	NAS1515H3L	Washer	

M104603

M.L

25.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

washer

M105143

M.L
07/08/17

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 12/04/2007 7:52:01 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 31807

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

26.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



(1X)

Comment: SMALL & MEDIUM FAB RESOURCE 1



Install tow Cap as per Dwg D3391

Identify as D3391-021

M.A.

07/08/17

27.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect thread of each insert using DT8821

EN 4/08/20

28.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: _____

PPP 33972

6/7/02

29.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

12/09/12 (1)

Job Completion



12/09/12

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

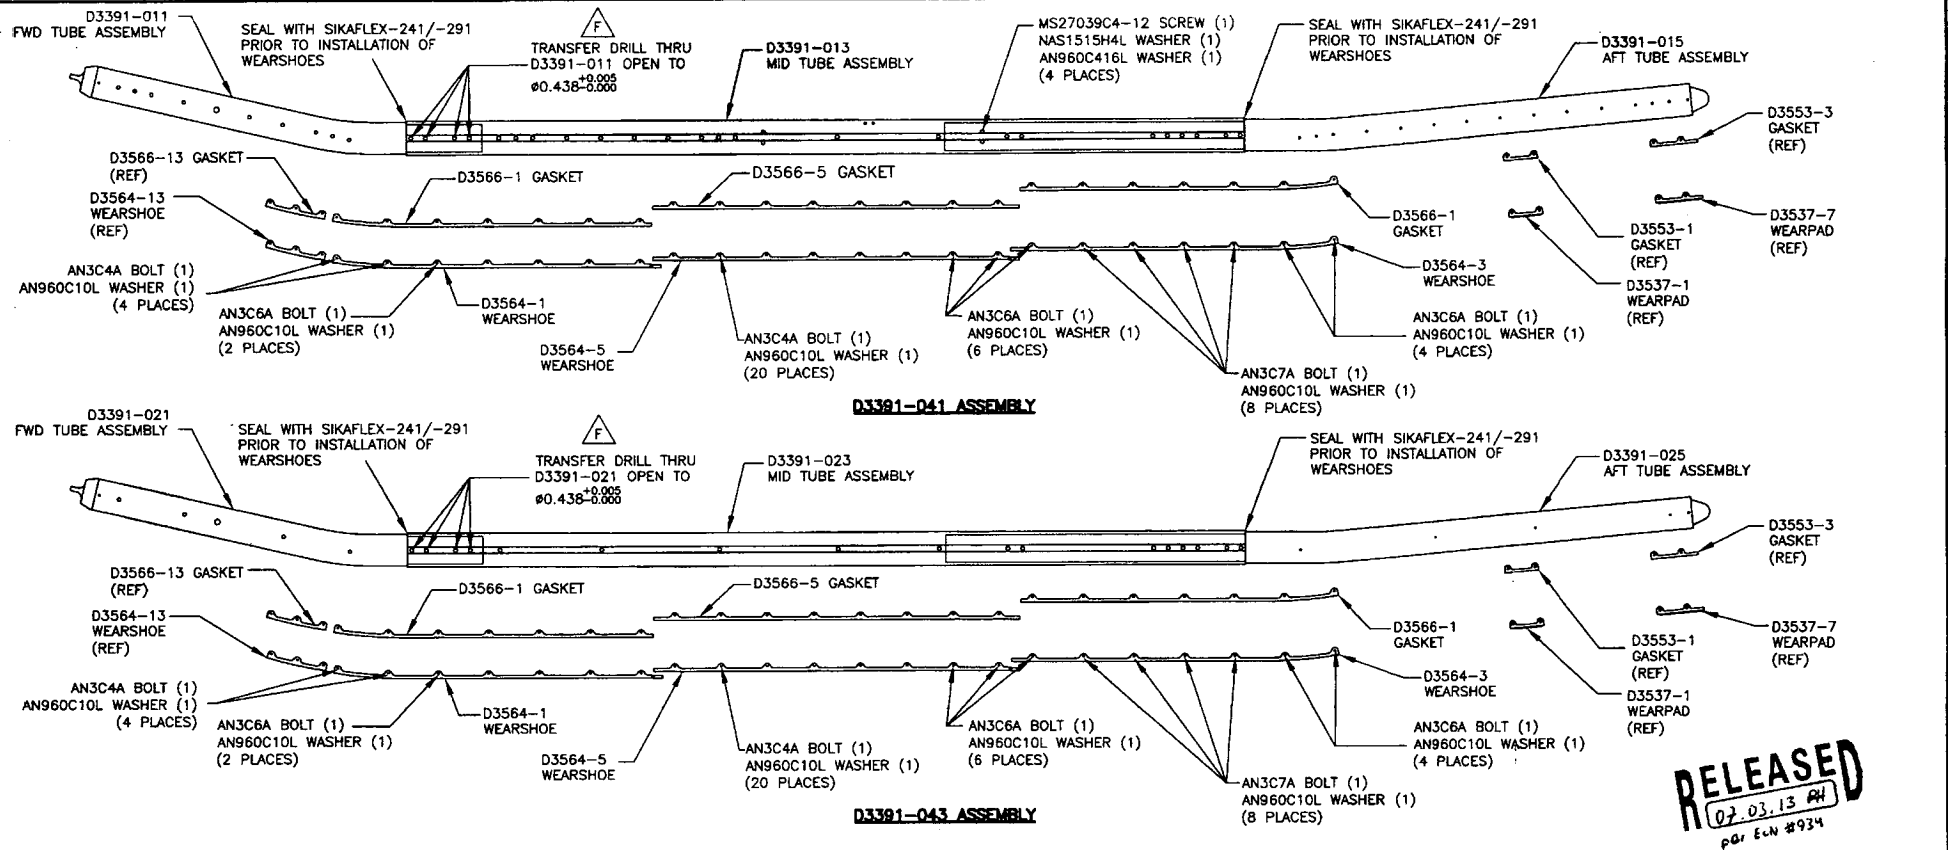

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	QTY	PART NUMBER	DESCRIPTION
-041	-043		
X	X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
		D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
1	1	D3391-021	FWD TUBE ASSEMBLY
1	1	D3391-023	MID TUBE ASSEMBLY
1	1	D3391-025	AFT TUBE ASSEMBLY
1	1	D3564-1	WEARSHOE
1	1	D3564-3	WEARSHOE
1	1	D3564-5	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
24	24	AN3C4A	BOLT
12	12	AN3C6A	BOLT
6	6	AN3C7A	BOLT
44	44	AN960C10L	WASHER
4	4	MS27039C4-12	SCREW
4	4	NAS1515H4L	WASHER
4	4	AN960C416L	WASHER

GENERAL NOTES

- ALL DIMENSIONS ARE IN INCHES
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- FINISH: ACID ETCH AND ALODINE PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL 'E' SIZE HOLES (Ø0.250-Ø0.257)
FOR WEARSHOE INSERTS. C/SINK Ø0.391/Ø0.425 x 100" AS APPLICABLE AND
INSTALL INSERTS EXCEPT WHERE INDICATED.


COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.



DESIGN	07.01.18	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021
E	06.04.25	CHANGE TOLERANCE, EASE MANUFACTURE
D	06.01.23	UPDATE TOLERANCE, CHANGE HOLE SIZE
C	05.09.27	LENGTHEN AFT EXTENSION
B	05.06.10	DRAWING UPDATES
A	05.02.07	NEW ISSUE
DESIGN	PH	DRAWN BY PH
CHECKED	H	APPROVED H
DATE	07.01.18	TITLE
		412 FLOAT SKIDTUBE
		REV. F
		SHEET 1 OF 5
		SCALE
		NTS

DART DART AEROSPACE USA, INC.
PORT HADLOCK, WA



DRILL "E"
($\phi 0.250 - \phi 0.257$)
C'SINK ($\phi 0.391 \times 100'$)
INSTALL
NAS1330S3KB166
(8 PLACES)



QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D6013-047	FWD TUBE
1	1	D3401-041	TOW CAP
1	1	D3564-13	WEARSHOE
1	1	D3566-13	GASKET
10	10	AN3C4A	BOLT
4	4	NAS1515H3L	WASHER
10	10	AN960C 10L	WASHER
30	20	NAS1330S3KB166	INSERT (OR NAS1330C3KB166)

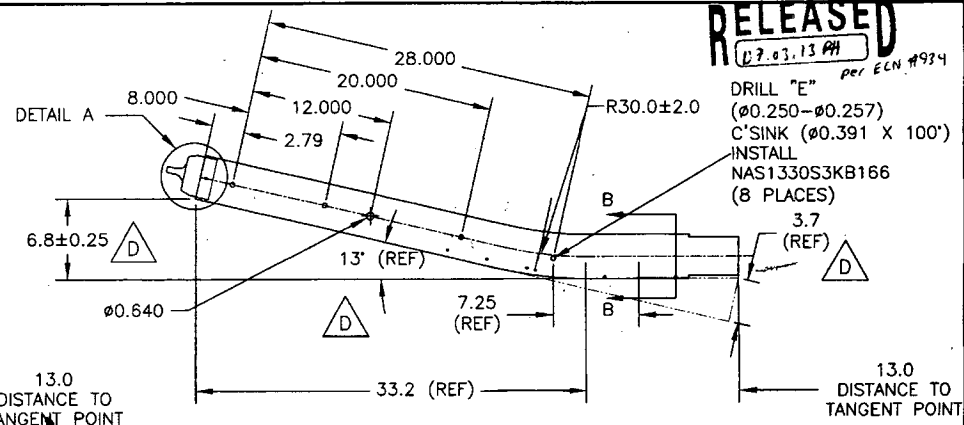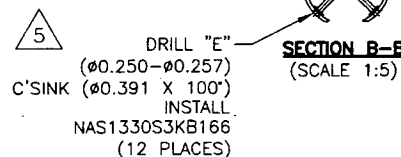


D3391-021 ASSEMBLY AND BENDING DETAIL

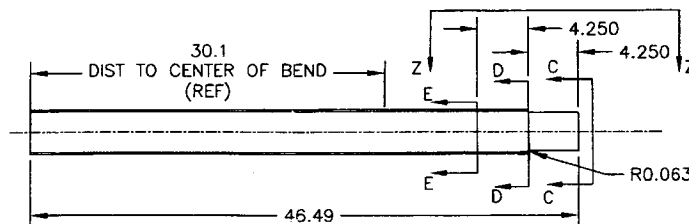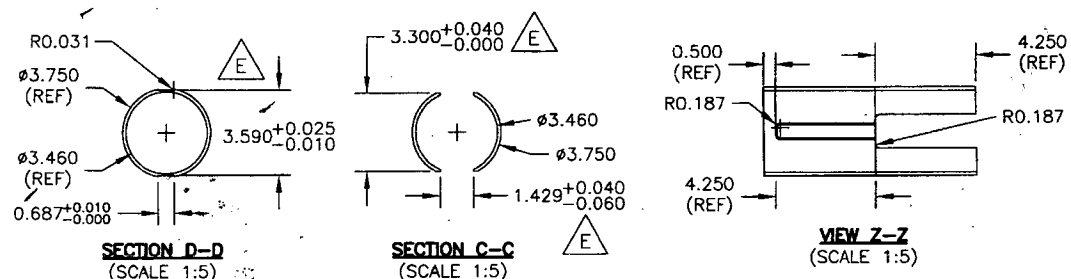

D3391-1 DRILLING AND CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)


COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


DESIGN	PH
CHECKED	
DATE	07.01.18

DRAWN BY	PH
APPROVED	A

DART		DART AEROSPACE USA, INC. PORT HADLOCK, WA	
DRAWING NO. D3391		REV. F SHEET 2 OF 5	
TITLE 412 FLOAT SKIDTUBE		SCALE 1:10	

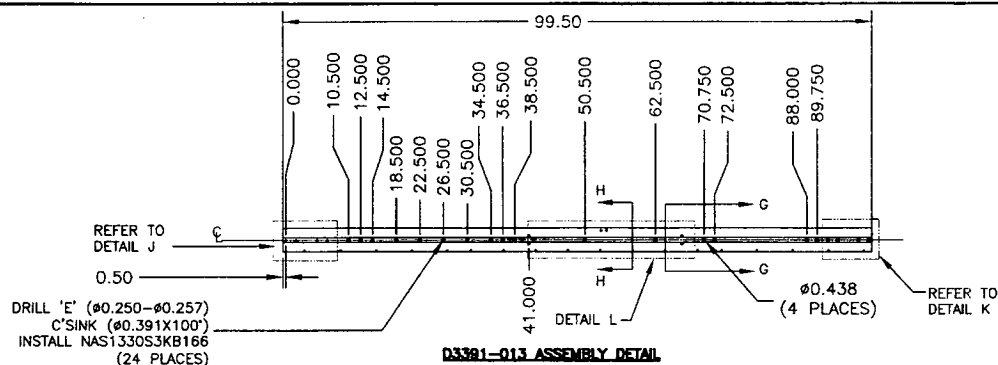


D3391-013 ASSEMBLY DETAIL

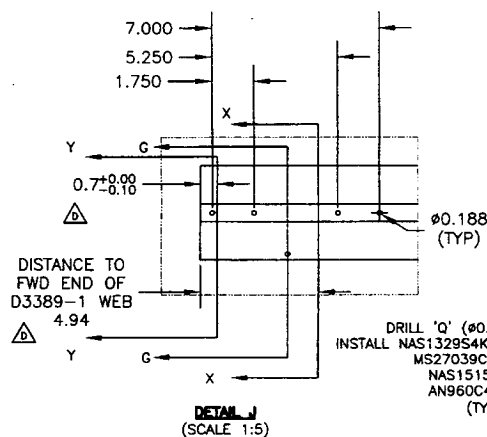


DETAIL J (SCALE 1:5)


DRILL 'O' (#0.332-#0.338)
INSTALL NAS1329S4KB140 INSERT
MS27039C4-08 SCREW
NAS1515H4L WASHER
AN960C416L WASHER
(TYP 4 PLACES)

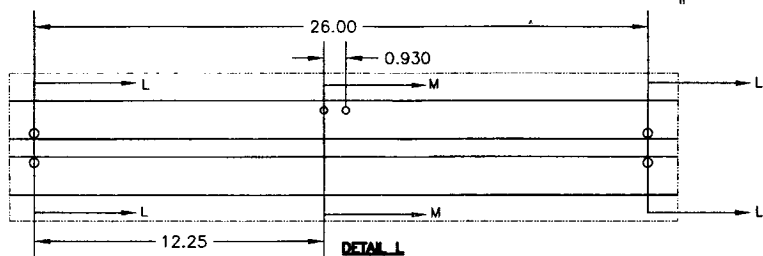


DETAIL L (SCALE 1:5)

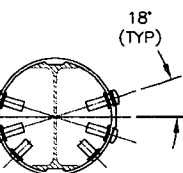


SECTION L-L (SCALE 1:4)

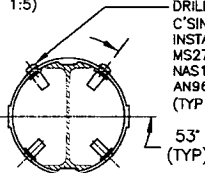


SECTION M-M (SCALE 1:4)

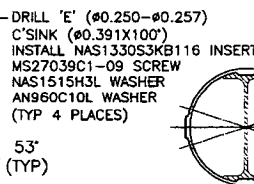

SECTION LL-LL (SCALE 1:4)




D3391-023 ASSEMBLY DETAIL

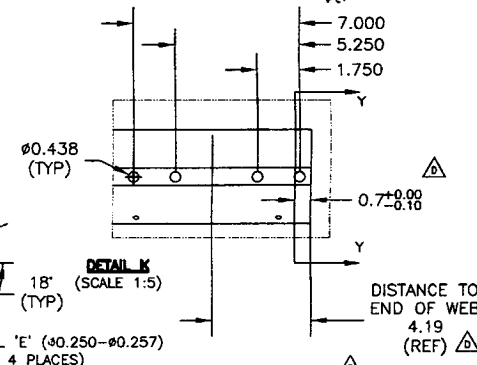

DETAIL K (SCALE 1:5)

DETAIL K (SCALE 1:5)


DETAIL K (SCALE 1:5)

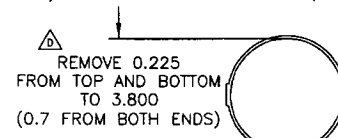

SECTION Y-Y (SCALE 1:4)



SECTION G-G (SCALE 1:4)

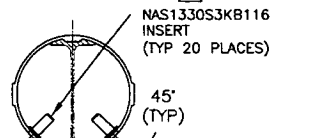

SECTION H-H (SCALE 1:4)

D3391-013/-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 013	QTY - 023	PART NUMBER	DESCRIPTION
X		D3391-013	MID TUBE ASSEMBLY
	X	D3391-023	MID TUBE ASSEMBLY
1	1	D2500-1-100	EXTRUSION
1	1	D3389-1	WEB
24	20	NAS1330S3KB116	INSERT (OR NAS1330C3KB116)
24	10	NAS1330S3KB166	INSERT (OR NAS1330C3KB166)
4		NAS1329S4KB140	INSERT (OR NAS1329C3KB140)
4		NAS1515H3L	WASHER
4		AN960C10L	WASHER
4		NAS1515H4L	WASHER
4		AN960C416L	WASHER
4		MS27039C1-09	SCREW
4		MS27039C4-08	SCREW

D3391-013/-023 MID TUBE ASSEMBLY


- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015

SECTION X-X (SCALE 1:2)


COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN RH	DRAWN BY RH	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED H	APPROVED H	
DATE 07.01.18	DRAWING NO. D3391	REV. F SHEET 3 OF 5 SCALE 1:20


RELEASED
07.03.13 RH
PER ECU #934

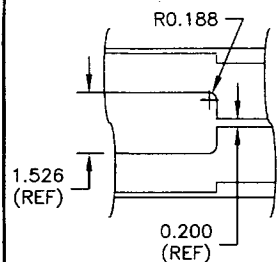


VIEW BB-BB
(SCALE 1:3)

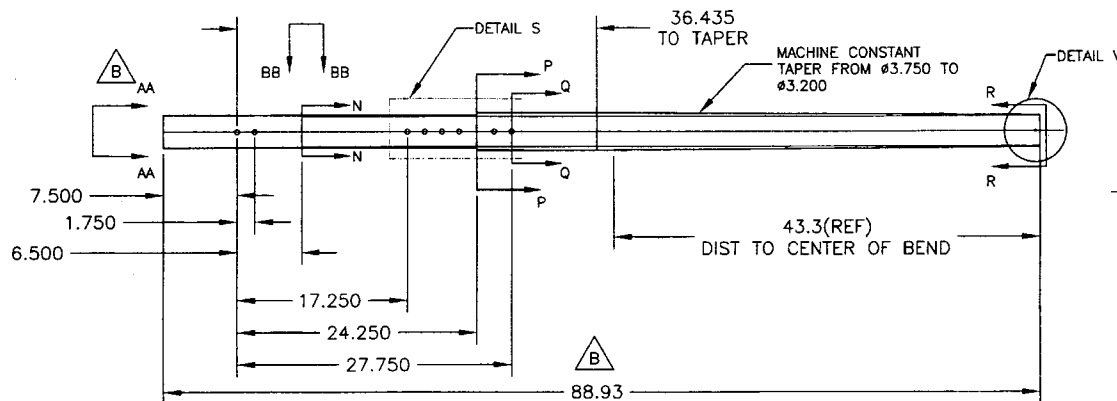


D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

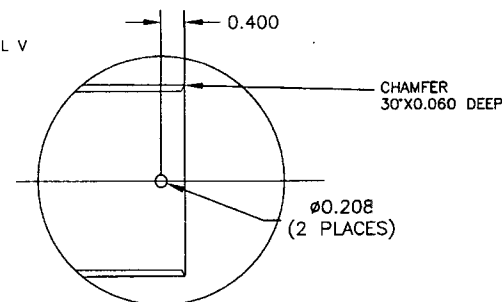


DETAIL V
(SCALE 1:2)

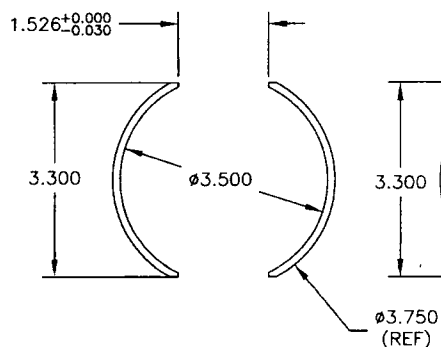


SECTION AA-AA
(SCALE 1:2)

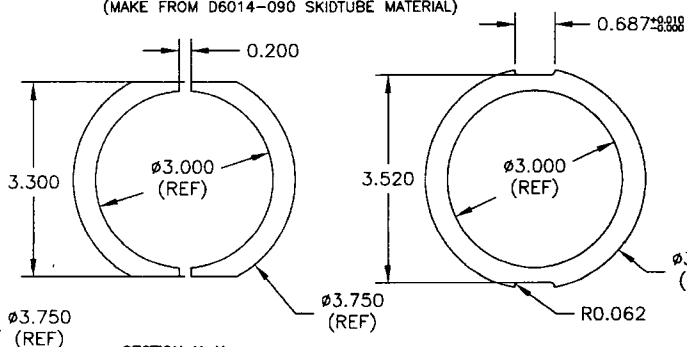


SECTION N-N
(SCALE 1:2)

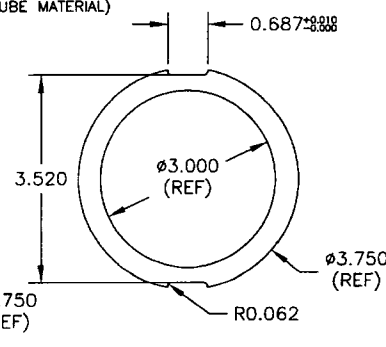


SECTION P-P
(SCALE 1:2)

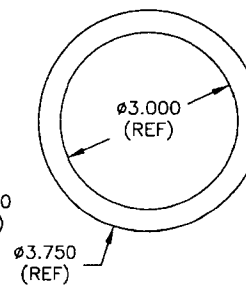


SECTION Q-Q
(SCALE 1:2)

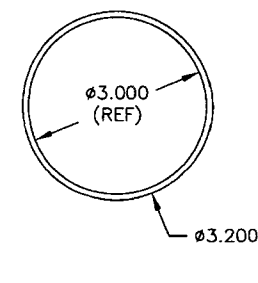

SECTION R-R
(SCALE 1:2)

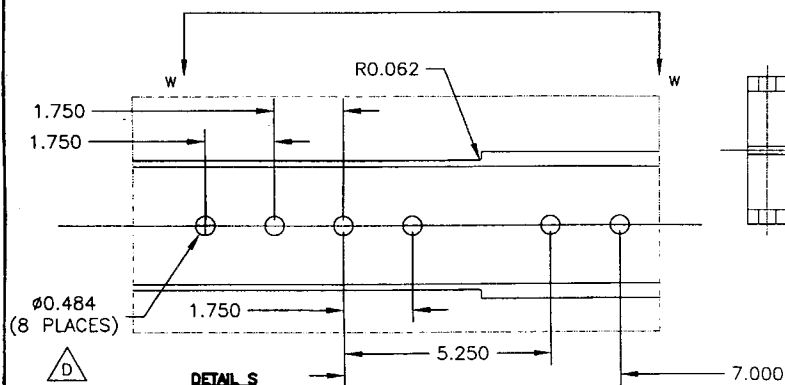

DETAIL S
(SCALE 1:3)

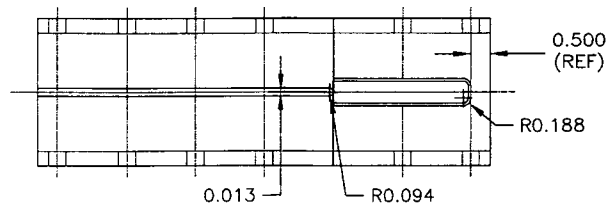


VIEW W-W
(SCALE 1:3)

RELEASED
07-05-13 PH
P/N ELN #934


COPYRIGHT © 2006 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


DESIGN	DRAWN BY	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO.	REV. F
DATE		D3391	SHEET 4 OF 5
07.01.18		TITLE	SCALE
		412 FLOAT SKIDTUBE	1:12

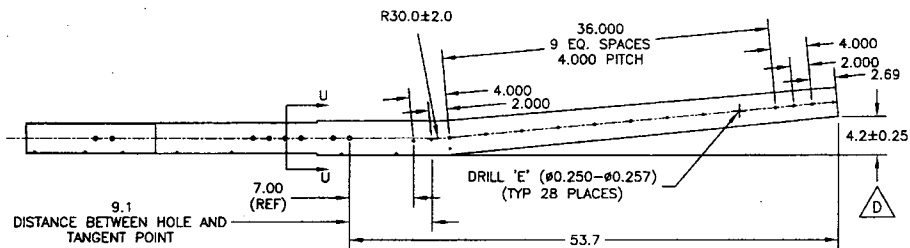


D3391-015 BENDING AND ASSEMBLY DETAIL

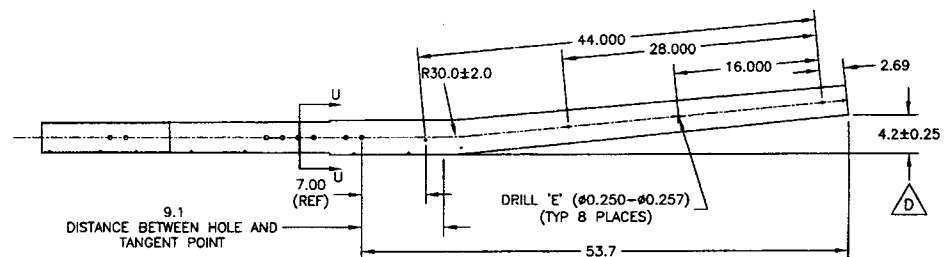

D3391-025 BENDING AND ASSEMBLY DETAIL

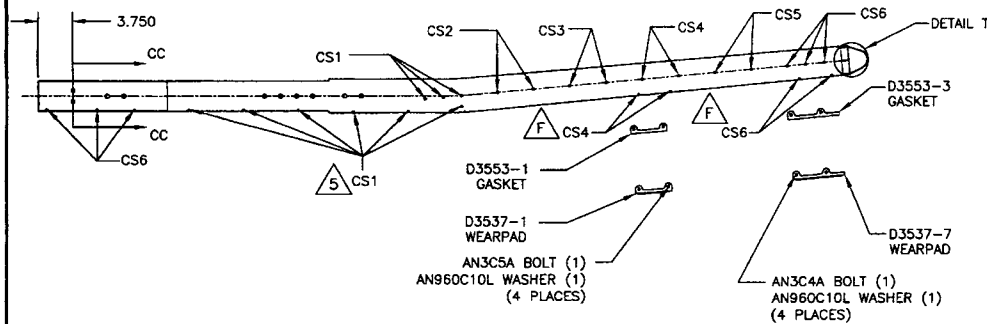


D3391-015 INSERT AND WEARPAD INSTALLATION DETAIL
(SEE TABLE)

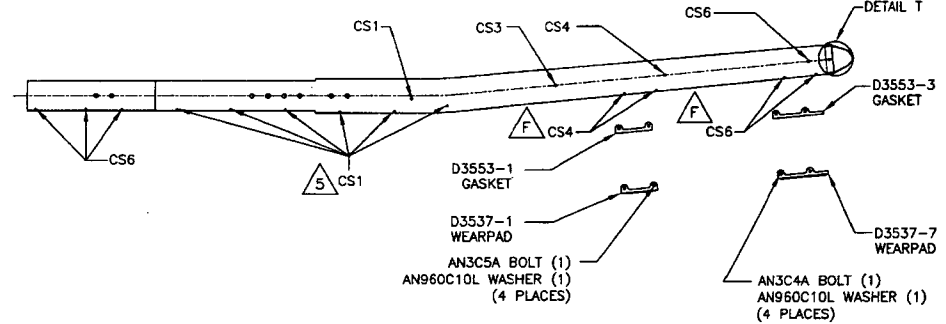



D3391-025 INSERT AND WEARPAD INSTALLATION DETAIL
(SEE TABLE)

D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
18	14	NAS1330S3KB366	INSERT (OR AES10KB366)
4	2	NAS1330S3KB316	INSERT (OR NAS1330C3KB316)
8	6	NAS1330S3KB266	INSERT (OR NAS1330C3KB266)
4		NAS1330S3KB216	INSERT (OR NAS1330C3KB216)
16	12	NAS1330S3KB166	INSERT (OR NAS1330C3KB166)
4		NAS1330S4KB151	INSERT (OR NAS1330C4KB151)
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
2	2	NAS1515H3L	WASHER
10	10	AN960C10L	WASHER

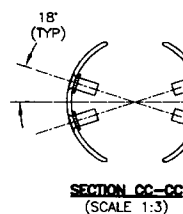

DRILL 'Q' (Ø0.332-Ø0.338)
C'SINK (Ø0.529X100")
NAS1330S4KB151 INSERT (1)
(4 PLACES)

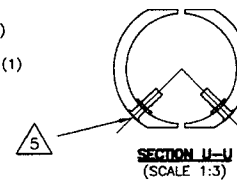

C'SINK AND INSTALL NAS1330S3KBXXX IN HOLES MARKED CS1-CS6 AS FOLLOWS

HOLES MARKED	QTY D3391-015	QTY D3391-025	C'SINK	P/N
CS1	18	14	Ø0.425	NAS1330S3KB366
CS2	4		Ø0.391	NAS1330S3KB366
CS3	4	2	Ø0.391	NAS1330S3KB316
CS4	8	6	Ø0.391	NAS1330S3KB266
CS5	4		Ø0.391	NAS1330S3KB216
CS6	16	12	Ø0.391	NAS1330S3KB166

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN R4	DRAWN BY R4	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED H	APPROVED H	
DATE 07.01.18		DRAWING NO. D3391 TITLE 412 FLOAT SKIDTUBE REV. F SHEET 5 OF 5 SCALE 1:12

RELEASED
07.03.13 #4
per ECN #734

DART AEROSPACE LTD		Work Order:	31807
Description: Fuel tube assembly		Part Number:	D3391-021
Inspection Dwg: 3391	Rev: F	Page 1 of 1	

FIRST ARTICLE INSPECTION CHECKLIST

<input checked="" type="checkbox"/>	First Article	<input type="checkbox"/>	Prototype
-------------------------------------	---------------	--------------------------	-----------

[illegible]

Measured by: JL	Audited by: gml	Prototype Approval:
Date: 07/05/14	Date: 07/05/17	Date:

Rev	Date	Change	Revised by	Approved
A		New Issue	KJ/JLM	

